

2020 DOOSAN DL300-5

Current Location: DYNAMIC EQUIPMENT, Lakeland, FL 33811, 863-250-8762

UNIT: DWGCWLDGHK1020363



UNIT SPECS

Customer PNC Equipment Finance

RECONDITIONING

Repair to Start	\$3,500	Paint: Damage	\$3,000
Body Panels: Left battery box damaged, Right battery box damaged,	\$4,000	Fenders: Left front missing, Left rear damaged, Right front missing, Right rear damaged	\$7,000
Left cab steps bent, Right cab steps missing	\$1,200	Left rear hand rails bent, Left front hand rails bent, Right front hand rails bent	\$1,500
Hood damaged	\$4,000	Seat Belts: Inoperable	\$275
Total			\$24,475





Doosan Infracore Co., Ltd.
489, Injung-Ro, Dong-gu,
Incheon, Korea

MODEL
제품명

DL300-5

PRODUCT IDENTIFICATION NUMBER
제품 식별 번호

>DWGCWLDG HK1020363<

MADE IN KOREA

950209-02977B













































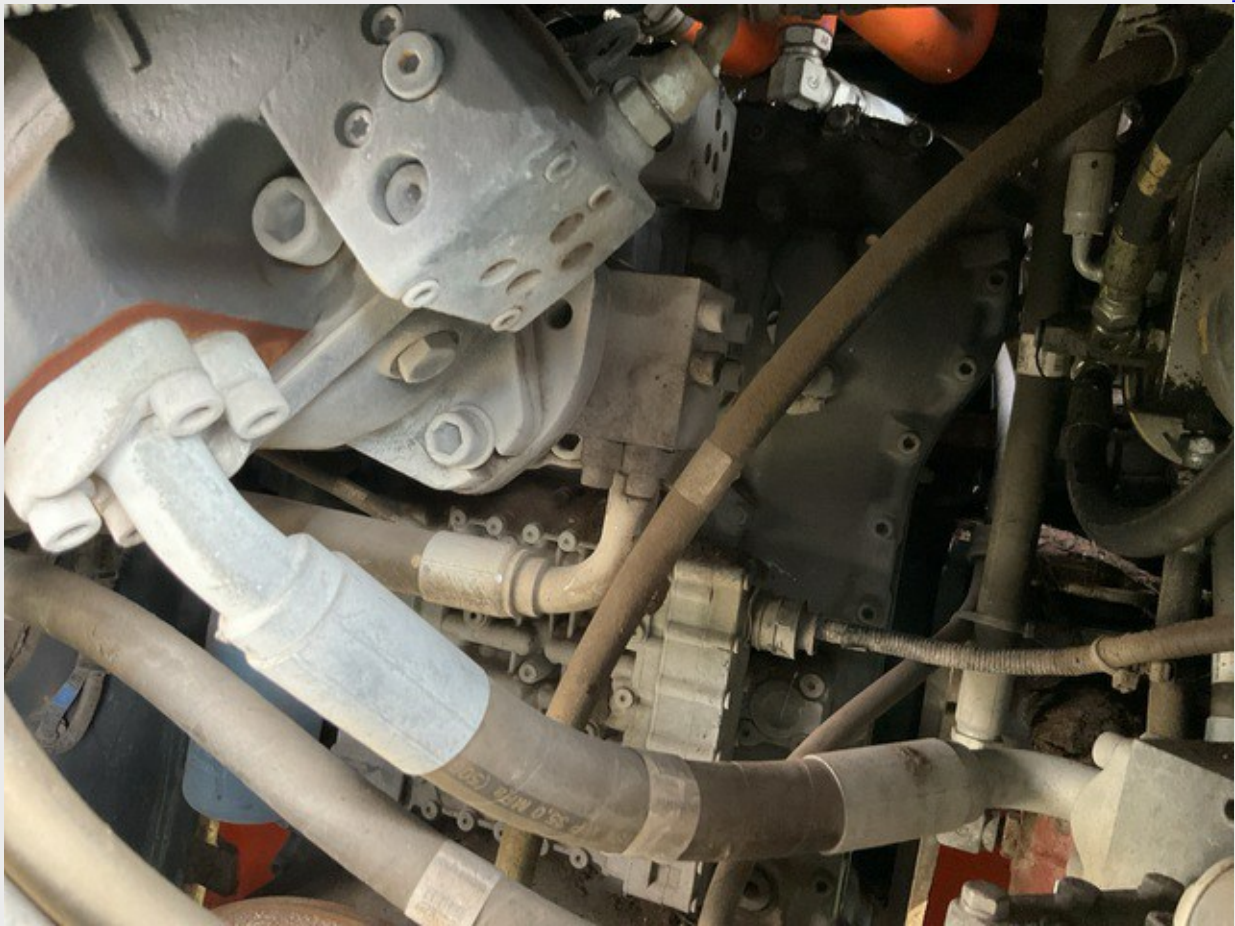





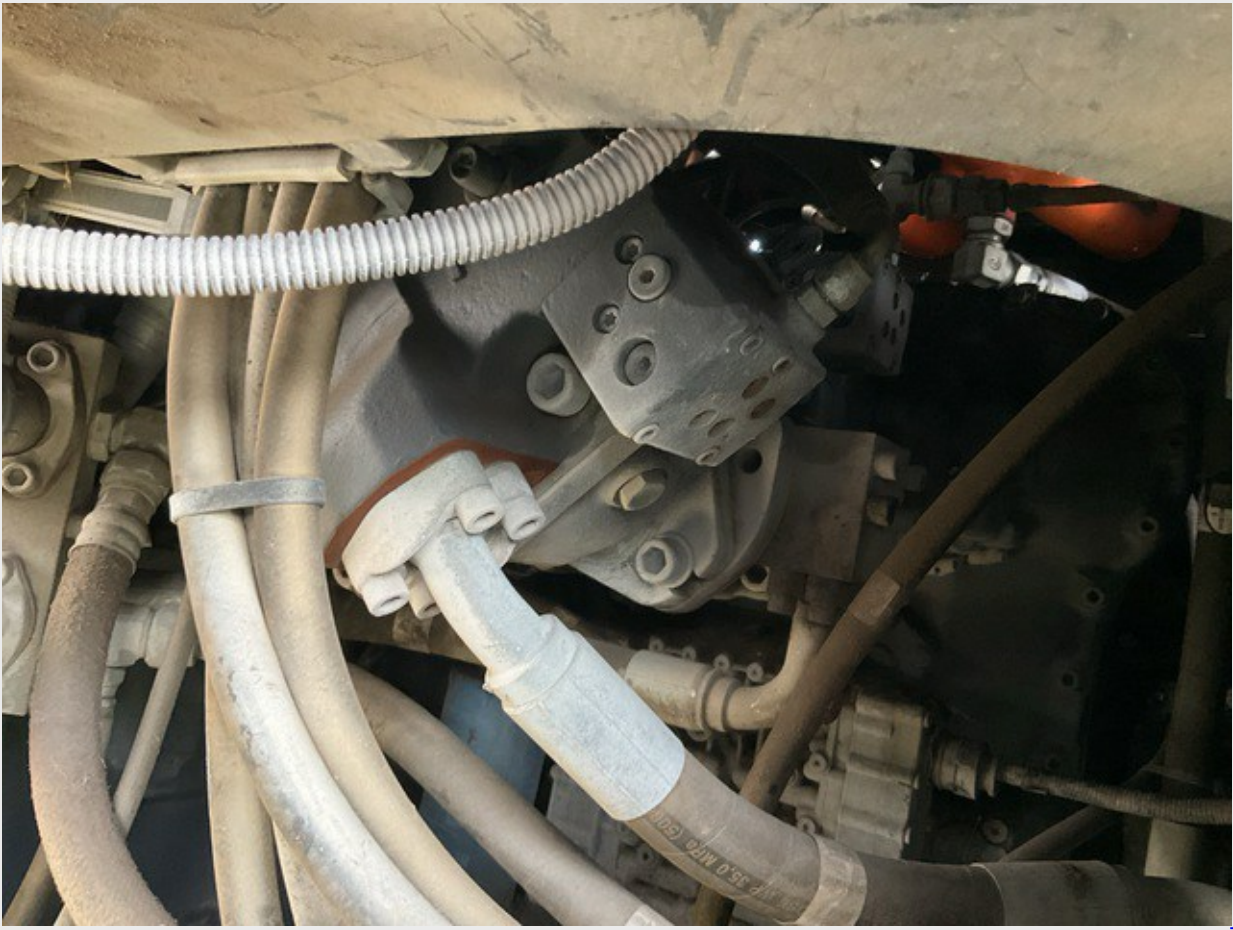






























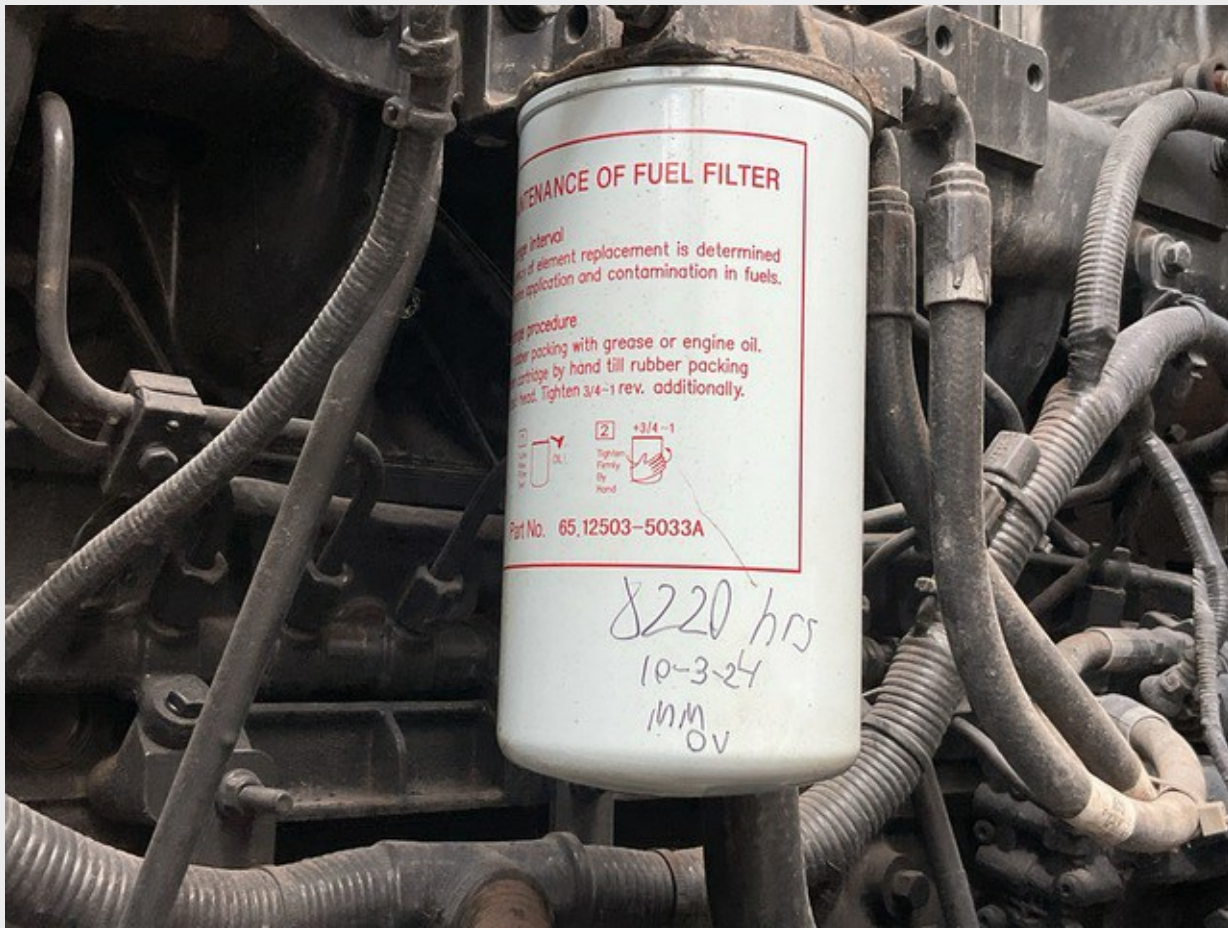

MAINTENANCE OF FUEL FILTER

Replacement interval
Frequency of element replacement is determined
by application and contamination in fuels.

Change procedure
1. Lubricate packing with grease or engine oil.
2. Turn cartridge by hand till rubber packing
is seated. Tighten 3/4-1 rev. additionally.



Part No. 65.12503-5033A

8220 hrs
10-3-24
11M OV