2023 DOOSAN DL200-7

UNIT: DHKCWLDTSN5050075





UNIT SPECS

Customer	PNC Equipment Finance

LOCATION

RTL Equipment
14833 164th Ave
Big Lake, MN 55309

GENERAL APPEARANCE

Year
2023

Make
Doosan

Model
DL200-7

Unit Number
212442

Pre-Operational Checks
Confirm Fluids Checked: Engine Coolant. Confirm Fluids Checked: Engine(s) Oil. Confirm Fluids Checked: Transmission Fluid. Confirm Fluids Checked: Hydraulic Fluid. Confirm Fluids Checked: Fuel Level

Paint
No visible damage

Body Panels
No visible damage or missing components.

Fenders
No visible damage or missing components.

Steps
No visible damage or missing components.

Hand Rails
No visible damage or missing components

Exterior Lights
All lights operational

Cab/Canopy Overhead Structural Framework
No visible damage

Serial Number / VIN
DHKCWLDTSN5050075

Serial Number
DHKCWLDTSN5050075

MODEL DESCRIPTION

Model Description
High Lift

SAFETY

Travel Alarm
Operational

Horn
Operational

Seat Belts
Operational

Current Safety Manual
No

Current Operator/Maintenance Manual
No

CONTROL STATION

Seat/Armrests
No visible damage or missing components

Glass
No visible damage or missing components

Cab Doors
No visible damage or missing components

Steering Controls
Rating:
Good

Hydraulic Controls
Rating:
Good

Drivetrain Controls
Rating:
Good

Dash Console
Rating:
Good

Engine Oil Pressure
The fault indicator shuts off after the engine oil pressure rises.

Warning Lights
Operational

Gauges
Operational

Rear View Camera
Camera operates as intended

Air Conditioner
The ambient temperature is too cold to check

Heater
Operational

Limited Function Check (Control Station)
The main components are in place and operational as noted.

Control Station
Cab Type, Enclosed Cab, Air Conditioner, Rear View Camera, Ride Control, Autoshift

Hour Meter /Odometer Usage Reading (Start)
349 hrs

Hour Meter / Odometer
350 hrs

ENGINE

A/C Compressor
In place; ambient temperature too cold to check operation

Blow-by (Subjective Visual Observation)
Minor

Starter
Operational

Exhaust System
No visible damage or missing components

Radiator
Rating:
Good

Oil Leaks
No dripping leaks

Limited Function Check (Engine)
The engine started and ran.

Engine
Requires Diesel Exhaust Fluid

DRIVETRAIN

Transmission
Rating:
Good

Front Drive Axle
Rating:
Good

Rear Drive Axle
Rating:
Good

Final Drives
Rating:
Good

Limited Function Check (Drivetrain)
The drivetrain was operational.

HYDRAULICS

Pumps (Hydraulics)
Rating:
Good

Valves
Rating:
Good

Hydraulic Tank
Rating:
Good

Hoses (Hydraulics)
Rating:
Good

Loader Lift Cylinders
Rating:
Good

Bucket Tilt Cylinders
Rating:
Good

Auxiliary Hydraulic Plumbing
Capped off, Front

Steering Cylinders
Rating:
Good

Limited Function Check (Hydraulics)
The hydraulic system was operational.

CHASSIS

Lift Arm Condition
Rating:
Good

Chassis To Arm Pins
Rating:
Good

Tilt Linkage
Rating:
Good

Tilt Linkage Pins And Bushings
Rating:
Good

Quick Coupler To Arms Pins
Rating:
Good

Limited Function Check (Chassis)
The main chassis components were operational in a limited check.

Articulating Center Pins
Rating:
Good

Brake Type
Hydraulic

Master Cylinder
Rating:
Good

Brake Lines/Hoses
Not operationally checked

Park Brake
Stopped from a slow roll
Rating:
Good

Limited Function Check - Brakes
The brake system functioned, stopping and holding the machine.

Frame Condition
Rating:
Good

Left Front Tire
Triangle TB516 20.5R25 35/32" Tread Depth
Rating:
Good

Left Rear Tire
Triangle TB516 20.5R25 36/32" Tread Depth
Rating:
Good

Right Rear Tire
Triangle TB516 20.5R23 36/32" Tread Depth
Rating:
Good

Right Front Tire
Triangle TB516 20.5R23 36/32" Tread Depth
Rating:
Good

Wheel Condition
No visible damage or missing components

SPECIALTY

Front Attachment
Auxiliary Hydraulics, Quick Coupler Type: Hydraulic Coupler, 101 in Bucket

Loader Bucket Condition
Rating:
Good

Loader Bucket Cutting Edge
No visible damage or missing components
Rating:
Good

Loader Quick Coupler
Doosan Coupler, Operational
Rating:
Good

CHECK SECTION


TIRE SIZE: 20.5R25

35/32


N/A
N/A

N/A

N/A

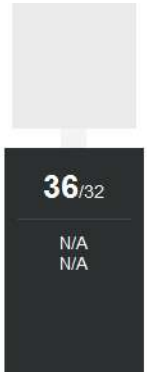

TIRE SIZE: 20.5R25

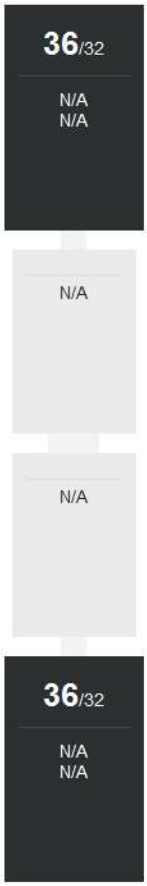

RECONDITIONING